

Date: Thursday, 16/08/2007 2:56:00 PM
User: Linda Lacelle

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 206L FWD X-TUBE
Job Number	: 34036		
Estimate Number	: 10553		
P.C. Number	: <i>N/A</i>	Part Number	: D206667103 <i>BL</i>
This Issue	: 16/08/2007 S.O. No. : <i>N/A</i>	Drawing Number	: D206-667-143 REVB
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: <i>N/A</i> Type : LANDING GEAR	Drawing Revision	: B
Previous Run	: 33686	Material	: <i>N/A</i>
Written By	: <i>[Signature]</i>	Due Date	: 05/08/2007 Qty: 1 Um: Each
Checked & Approved By	: <i>[Signature]</i>		
Comment	: Est Rev: 05.09.01 Add holes for compatibility with Bell Skid tubes KJ/JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D206-667-103 CHG002

*KS 07.08.29**[Signature] 07/08/28*

2.0	D6002115	Crosstube material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6002-115 Crosstube *B29113*

Check OD = 2.250"; ID = 1.750"

JS 07/08/21 ①

3.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA087

2-Turn first side as per Folio FA087

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143.

JS 07/08/21 ①

QC1

INSPECT ALL DIM TO DIM SHEET



ent: INSPECT ALL DIM TO DIM SHEET

JS 07/08/21

H-I-FORMS Quality Assurance Department

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 16/08/2007 2:56:00 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 34036

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA087

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143.

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D206-667-143

Inside of Cuff(Donot engrave on outside of tube)

28 07/08/21

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

28 07/08/21

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

28 07/08/21

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Polish entire outside surface of crosstube

JD 7-8-29

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

FA08-290

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

JD 7-8-29

11.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D206-667-143 using CNC bender program 206L-fw and Folio FT017

EL 7-9-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 16/08/2007 2:56:00 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 34036

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

QC15

DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

2009-10

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1



1-Drill pilot holes in tube using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8541 & DT8542 as per Dwg D206-667-143

6-Drill Fwd rivet holes using drill Jig DT8787FWD as per Dwg D206-667-143. Note: Fwd side has 3x top holes.

7-Drill Aft rivet holes using drill Jig DT8787AFT as per Dwg D206-667-143.

8-C'sink holes as per Dwg D206-667-143. Allow rivet to sit below surface to compensate for paint.

9-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143

07-09-15

Job 7-9-17

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

Job 7-9-17

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

2009-18

16.0

QC5

INSPECT WORK TO CURRENT STEP








Comment: INSPECT WORK TO CURRENT STEP

2009-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 27/09/17
 QA: N/C Closed: _____ Date: _____

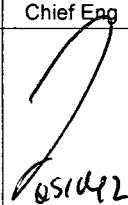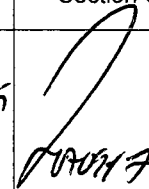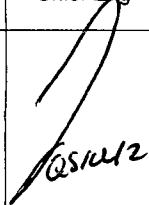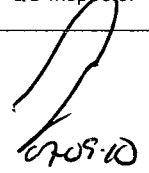NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
070910	13.0	Tube in slightly over bent on one side.		Drill per dim sheet.	 07-09-17			

NOTE: Date & initial all entries

Date: Thursday, 16/08/2007 2:56:00 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 34036

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

OUTSIDE SERV.10

OUTSIDE SERVICES -LG



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038Or

Issue P/O: 4617 LPI as per ASTM 1417

Level 2 Attach copy of NDT results to work order

C207/09/19 ①

18.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage

Ensure copy of NDT results attached to work order.

7/9/19 SP

19.0

QC6

DIMENSIONAL CHECK



Comment: Inspect for damage & ensure results are as per Dwg D206-667-103

7/9/19 ①

20.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Intron as per QSI 005 4.2

PG

IT 07-09-19

Issue P.O

4630

C207/09/20 ①

Atelier Debossel 2010

spray paint Del Fleet Blue + clear

21.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Wrap in plastic bag to protect from scratches

7/9/19 ①

22.0

D2856400

Abrasion Strip



Comment: Qty.: 1.2138 f(s)/Unit Total: 1.2138 f(s)

Pick:

Qty Part number Description Batch

2 D2856-400(Cut to 6.94") Abrasion Strip

34293

ml 07 09 25

Job R9

Review & Inspect for transit damage

7/9/19 SP

C207/24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 16/08/2007 2:56:00 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 34036

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

D2873043

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch
2 D2873-043 Nut Plate

32512

07-07-19

24.0

D2873045

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch
2 D2873-045 Nut Plate

32777

07-09-19

25.0

D28911

Support 2.25 dia



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch
2 D2891-1 Support

34141

07 09 25

26.0

MS20601AD4W8

RIVET



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part number Description Batch
14 MS20601AD4W8 Rivet

105057

07 09-19

27.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch
4 MS21920-20 Clamp

104423

07 09 25

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 16/08/2007 2:56:00 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 34036

Part Number: D206667103

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

28.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
------	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8579. .Note: (2) Aft holes should be facing up.

2-Install supports and clamps as per Dwg D4206-667-143. Torque clamps to 80-100 in lb

3-Install nut plates as per Dwg D206-667-143. Touch-up rivet heads with Imron paint.

ml
070925

FT 07-09-19

29.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

1709-26 @

30.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

31.0	AN532A	Bolt
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch:

M103962 -

CP

32.0	MS21042L5	Nut
------	-----------	-----



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Nut

Batch:

M104812 -

CP

33.0	AN57A	Bolt
------	-------	------



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

10 AN5-7A

Bolt

M104885 -

CP

CP 07/09/26 @

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 16/08/2007 2:56:00 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 34036

Part Number: D206667103

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

34.0	AN530A	BOLT
------	--------	------



S Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

4 AN5-30A

Bolt

1103641

35.0	AN960JD516	Washer
------	------------	--------



S Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

18 AN960JD516

Washer

1104156

CP 07/09/26

36.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
------	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

CP 07/09/26

37.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-667-103

Location:

PPP Rev:

B 7/9/26 SP

W

38.0	QC21	FINAL INSPECTION/W/O RELEASE
------	------	------------------------------



Comment: FINAL INSPECTION/W/O RELEASE

CP 07/09/27

Job Completion



CP 07/09/27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED HDS	APPROVED HDS	DRAWING NO. D206-667-143	REV. B SHEET 1 OF 3
DATE 05.07.26		TITLE CROSSTUBE ASS'Y (206L HIGH FWD)	SCALE NTS
A	00.11.17	NEW ISSUE	
B	05.07.26	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	

05-07-26

UNDER REVIEW

06.08.10 PH

re-draw detail F

Qty	Part Number	Description
X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
1	D6002-115	CROSSTUBE
2	D2873-043	NUT PLATE
2	D2873-045	NUT PLATE
2	D2856-400-694	ABRASION STRIP
2	D2891-1	SUPPORT
14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
4	MS21920-20	CLAMP

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6002-115
FINISHED LENGTH = 104.98±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-694 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2891-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) IT IS OPTIONAL TO SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING SIKAFLEX-241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.





W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

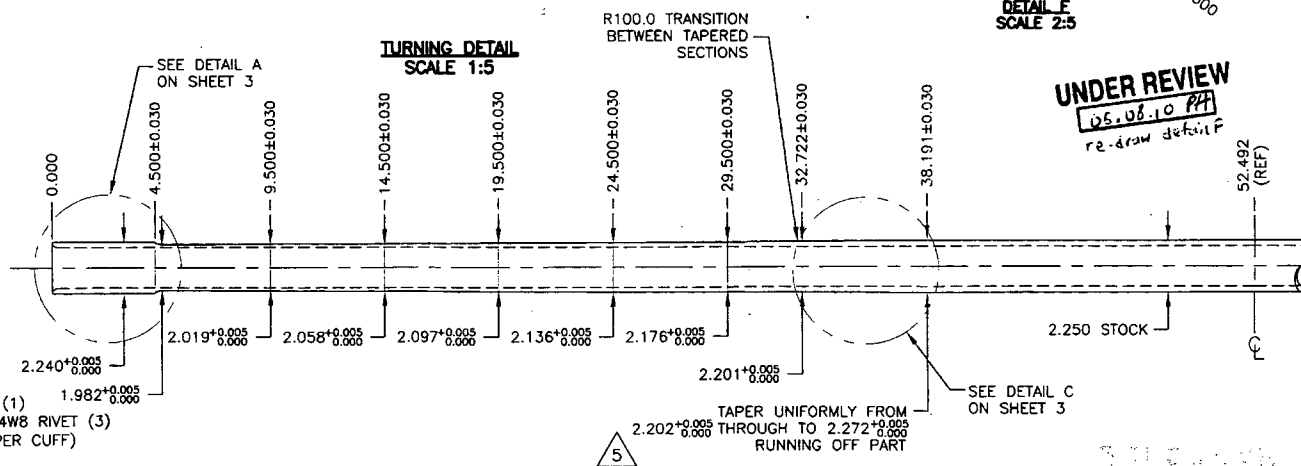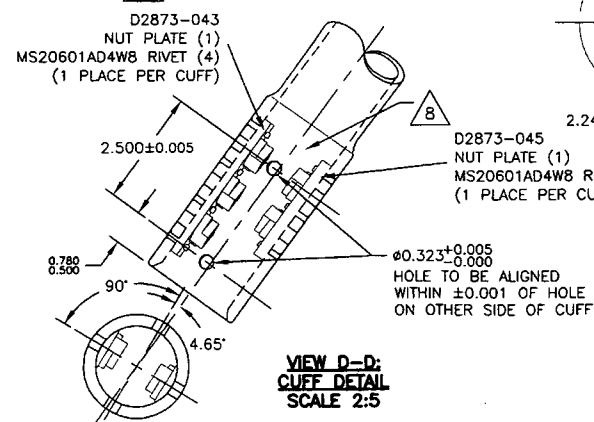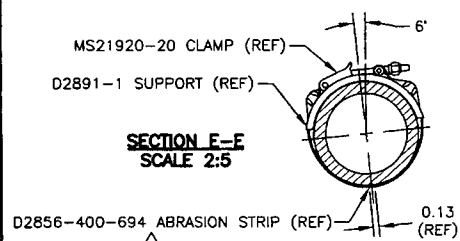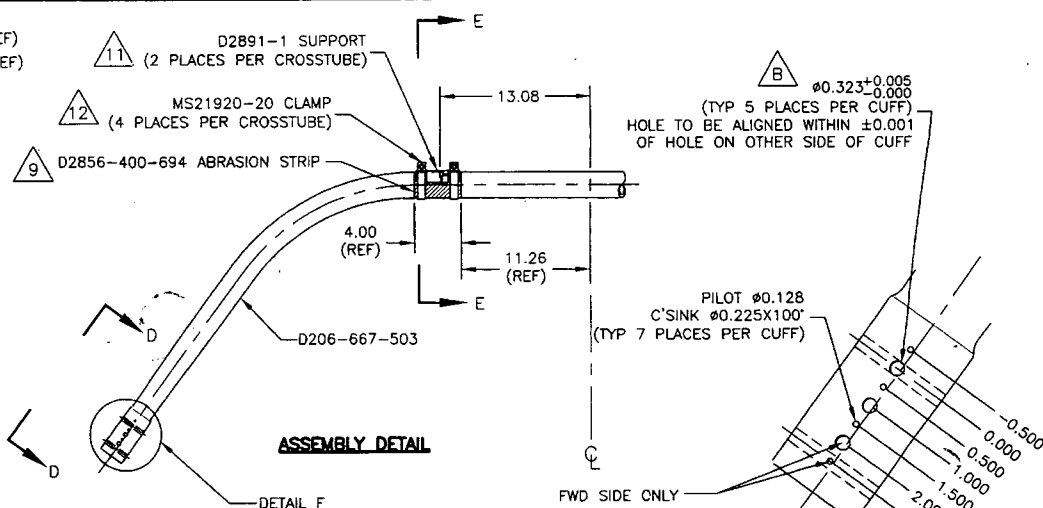


UNDER REVIEW
05.08.10 PAF
re-draw detail

52.492
(REF)

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN	DRAWN BY	 DART AEROSPACE LTD. MARKHAM, ONTARIO, CANADA
PH	PH	
CHECKED	APPROVED	DRAWING NO.
 DS	 OS	D206-667-143
DATE	TITLE	
05.07.26	CROSSTUBE ASS'Y (206L HIGH FWD)	
		SCALE
		1:10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

DETAIL A: CROSSTUBE CUFF

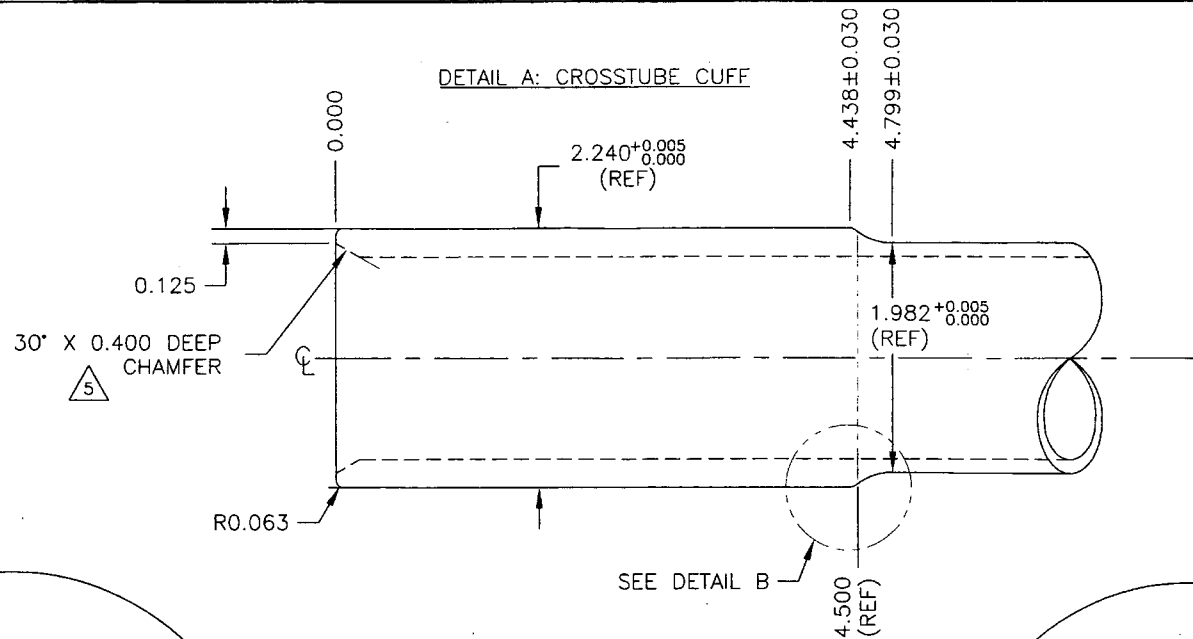


05.07.26 #

UNDER REVIEW
28.08.10 PH
re-draw detail F

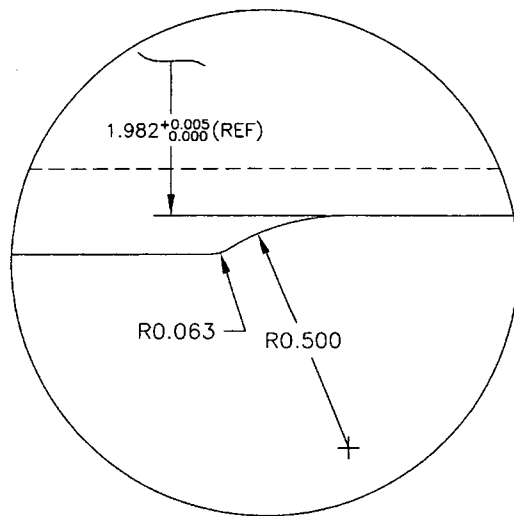

DETAIL C: TAPER RUN-OFF NOT TO SCALE

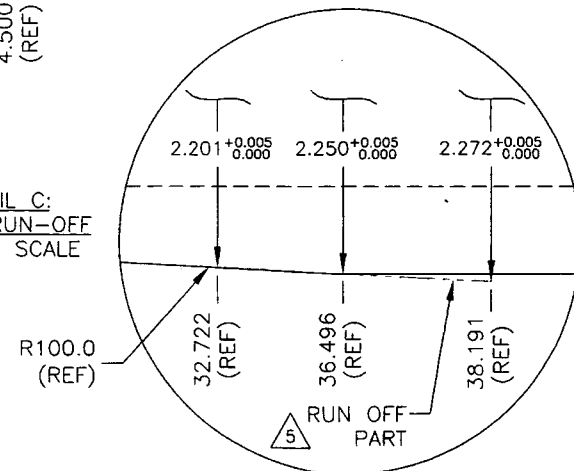

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	PH	DRAWN BY	PH
CHECKED	PH	APPROVED	PH
DATE	05.07.26		

DART

DART AEROSPACE LTD.
HARRISBURG, ONTARIO, CANADA

DRAWING NO.
D206-667-143

TITLE
CROSSTUBE ASS'Y (206L HIGH FWD)

REV. B
SHEET 3 OF 3

SCALE
1:1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 34036
Description: Crosstube Assembly (206L High Fwd)	Part Number: D206-667-143
Inspection Dwg: D206-667-143 Rev: B	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000 2.242				
	1.982	+0.005/-0.000 1.986				
	2.019	+0.005/-0.000 2.023				
	2.058	+0.005/-0.000 2.062				
	2.097	+0.005/-0.000 2.101				
	2.136	+0.005/-0.000 2.140				
	2.176	+0.005/-0.000 2.180				
	2.201	+0.005/-0.000 2.205				
	0.125	+/-0.010 .125				
	0.400 x 30°	+/-0.010 .400				
	R0.063	+/-0.010 .063				
	R0.500	+/-0.010 .500				
	4.438	+/-0.030 4.437				
SIDE B	104.98	+/-0.020 104.98				
	2.240	+0.005/-0.000 2.244				
	1.982	+0.005/-0.000 1.986				
	2.019	+0.005/-0.000 2.023				
	2.058	+0.005/-0.000 2.062				
	2.097	+0.005/-0.000 2.101				
	2.136	+0.005/-0.000 2.140				
	2.176	+0.005/-0.000 2.180				
	2.201	+0.005/-0.000 2.205				
	0.125	+/-0.010 .125				
	0.400 x 30°	+/-0.010 .400				
	R0.063	+/-0.010 .063				
	R0.500	+/-0.010 .500				
	4.438	+/-0.030 4.437				

Measured by: JS	Audited by: SE	Prototype Approval:	N/A
Date: 07/05/21	Date: 07-05-21	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	04.05.06	New Issue (P/O D206-667-103)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	34036
Description: Crosstube High Fwd (206L)		Part Number:	D206-667-103
Inspection Dwg: D206-667-143 Rev: B		Page 1 of 1	

Required Dimension	Min	Max
Height	23.46	23.58
1/2 Span	41.86	41.98
Angle	54	56
Total Span	83.72	83.96

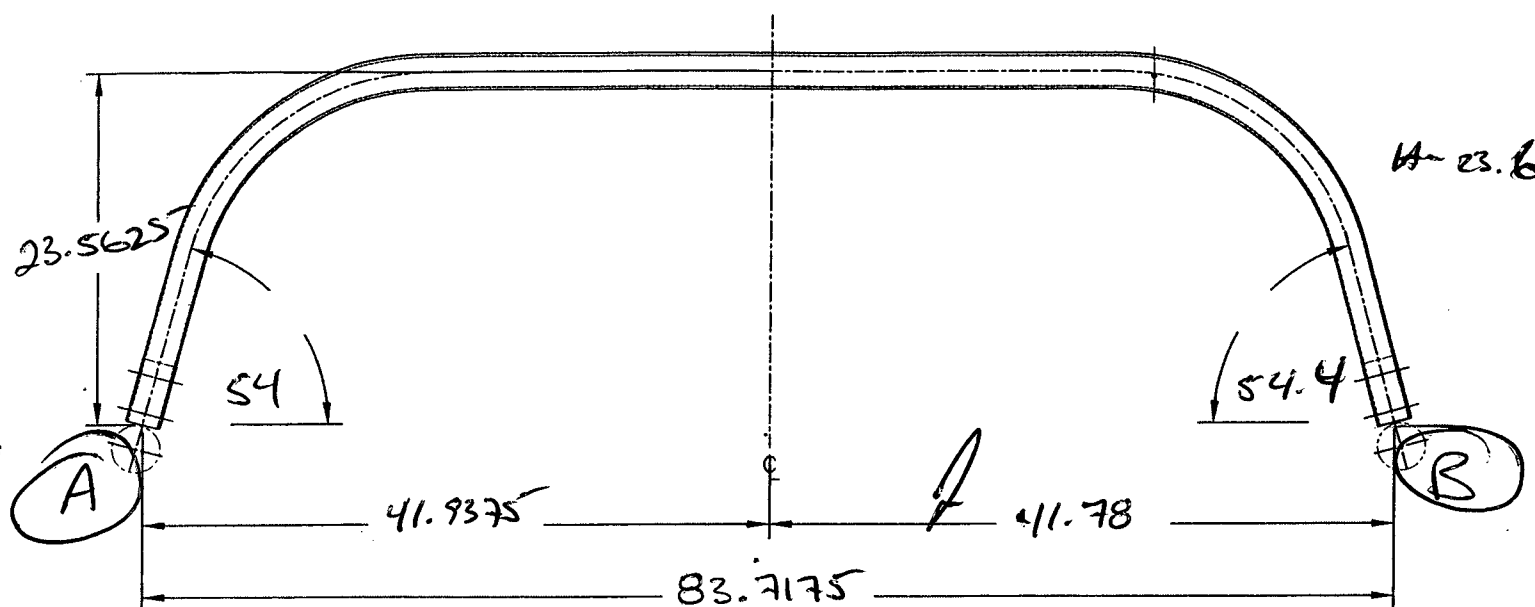

Comments
- One side slightly over bent, but within tolerance.
- Drill side 'A' at .740" on the cup height.

QC15 Inspection	<i>[Signature]</i>
Date	1709-10

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	<i>[Signature]</i>

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



LIQUID PENETRANT TEST REPORT

P - 1269 1

CLIENT	DART AEROSPACE	DATE	SEP 18 2007	PAGE	1	OF	2
ATTENTION	LINDA LACELLE	ACUREN JOB NO.	188 07 1269	TIME	AM <input type="checkbox"/>	PM <input type="checkbox"/>	
ADDRESS	1270 ABERDEEN ST	PO/NO					
	HAWKESBURY, ONT.	WORK LOCATION	HAWKESBURY				
		ACCEPTANCE STD.	ASTM 1417/QSI-038	REV./DATE	2005		
PROJECT	CROSSOVER TUBES						
ITEM(S) EXAMINED	JOB #'S 33159, 34036, 34038, 34044, 34045						

JOB DESCRIPTION	PROCEDURE NO. LT-0002	REV./DATE	TECHNIQUE NO. LT-TECH2	REV./DATE
PART NO. D206667103	MATERIAL	7075 ANODIZED ALUM.	THICKNESS	
SCOPE	WET FLOURESCENT LIQUID PENETRANT INSPECTION CARRIED OUT ON 100% EXTERNAL SURFACE			

TEST DETAILS

METHOD	<input checked="" type="checkbox"/> FLUORESCENT	<input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> WATER WASH	<input type="checkbox"/> SOLVENT REMOVABLE	<input type="checkbox"/> POST EMULSIFIED
FAMILY BRAND	MAGNAFLUX		BLACK LGHT8171	<input type="checkbox"/> OUTPUT > 1000 μ W/CM ²	<input type="checkbox"/> AMBIENT < 2 fc
PENETRANTZL67	MINIMUM DWELL TIME	30 MIN.	LIGHTING EQUIP.	<input type="checkbox"/> FLASHLIGHT	<input type="checkbox"/> TROUBLELIGHT
PENETRANT REMOVER H2O	MINIMUM DRY TIME	>10 MIN.	OTHER	CAL SEP 18 07	
DEVELOPER SKDS2	MINIMUM DWELL TIME	10 MIN.	LIGHT METER S/N	CAL DUE DATE	
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS	<input type="checkbox"/> AQUEOUS	<input type="checkbox"/> DRY		

TEST SURFACE

SURFACE CONDITION	<input type="checkbox"/> AS GROUND	<input checked="" type="checkbox"/> AS WELDED	<input type="checkbox"/> MACHINED	<input type="checkbox"/> SHOT BLASTED	<input checked="" type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < - 4°C/ 20°F	<input type="checkbox"/> - 4°C/ 20°F TO 10°C/50°F	<input type="checkbox"/> 10°C/50°F TO 52°C/125°F	<input type="checkbox"/> > 52°C/125°F	

RESULTS- (☐ METRIC ☒ IMPERIAL)

FLUORESCENT LIQUID PENETRANT INSPECTION
CARRIED OUT ON 100% EXTERNAL SURFACE ON
CROSSOVER TUBES FOR JOB#S 33159, 34036,
34038, 34044, 34045.

RESULTS: NO INDICATION OF DEFECTS.
ITEMS ACCEPTABLE TO STANDARD.

Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner-operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner operator and the owner operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE		DTR# E 13158		
TECHNICIAN (SIGNATURE):		REPORT REVIEWED BY:		
NAME (PRINT):	JASON HEWETT	NAME INITIALS		
	1 ST TECHNICIAN	2 ND TECHNICIAN		
CGSB LEVEL	2	SNT LEVEL	CGSB LEVEL	SNT LEVEL
CGSB REG. No	6156	CGSB REG. No		

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY